

ART CLAY™ SILVER **Basic Instruction Guide #062**

Star Sign Pendant with Brass Wire and Ball

Level: Beginners/Intermediate




<Materials>

Art Clay Silver Clay Type	10-15g
Brass ball 3mm or 4.5mm	
Brass wire 0.8mm	approx. 5cm

Completed piece


<Step by Step Guide>

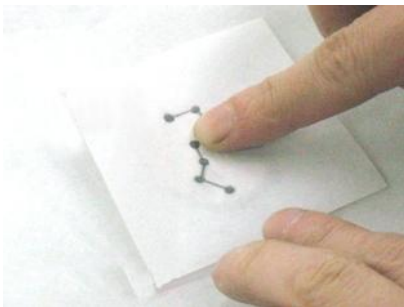


1. Draw a star design with Stabilo pencil. Roll out the clay 2.5mm thick. Trace down.



2. Moisten the surface so as not to delete outline. Embed the brass balls and brass wire to fix firmly. Also, you can drill a hole and set fireable synthetic stones. Cut out the flame with a craft knife, insert a flat screw eye into the top, and dry.

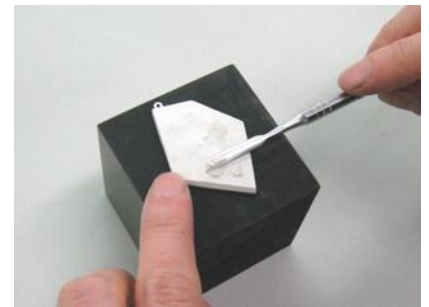

3. File the piece with a medium fine file. Paint a small amount of Paste Type on the brass balls and wire to prevent crack the piece or detach the balls and wire with a spatula. Dry.

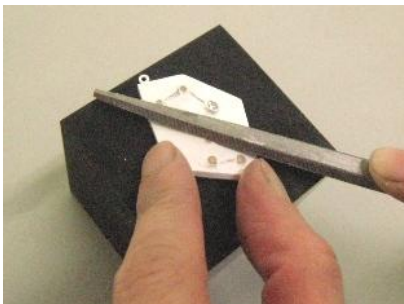

4. You can drill a shallow hole with a 2mm drill bit, or make 2 layers around the holes with a green nozzle syringe and set a 3mm synthetic stones. Fire in an electric kiln at 800C/1472F for 5 minutes. Polish with a stainless steel brush and sponge sanding pads until the brass wires and balls appear. Can finish with a small amount of liver of sulphur, and polish.